

Certified, Filed and or Recorded on
Mar. 23, 2010 AT 11:47AM

Signed: JL
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 20, Township 37, Range 30
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 7/21/2006 found a CAST IRON MONUMENT

left monument as found lowered monument removed monument (explain)
 On _____ placed an _____

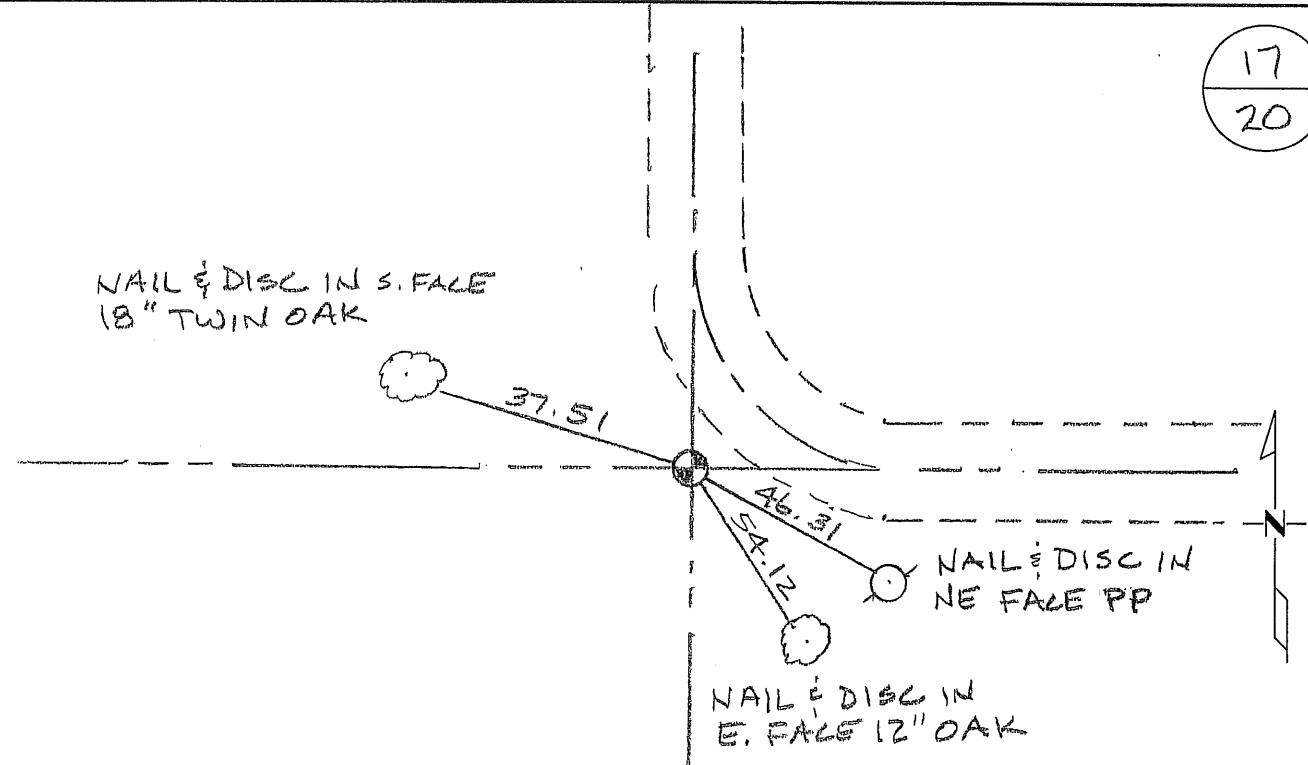

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature: Jerome C. Wittstock
Benton County Surveyor
License No. 19552

Date: 3-22-2010

Statement of Evidence:**G201**

North Quarter Corner of Section 20, Township 37 North, Range 30 West, Mayhew Lake Township, 4th Principal Meridian, Benton County, Minnesota.

1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

36" Bur Oak	N 32 W	36 links
13" Bur Oak	S 32 E	8 links

1939 County Engineer's Notebook No. 158 contains road survey for CAR No. 20 running from the east along the section line and then north. Corner is shown as an iron pipe at the PI of the road. Ties:

18" Ash	SE	41.0
12" W. Oak	S	67.5

Stationing gives distances of 2659.8 feet to the NE corner.

1959 Notebook No. 158 lists new ties:

PP	SE	47.1'
Twin W. Oak	W	37.1'

1977 Paul Wollen, LS 10461, found a 1/2" iron monument at the P.I. of the road north and east and a fence corner. Filed Certificate of Location (Doc. No. 147251).

Ties to possible 1959 ties:

PP	SE	46.32'
10" Twin W. Oak	W	37.51'

2001 Westwood Professional Services, Inc. found a 1" iron pipe at the P.I. of the road north and east. They removed the 1" iron pipe and set a cast iron monument at the location and established reference ties.

2001 Westwood Professional Services, Inc. set a cast iron monument at the location of a found/removed 1" X 24" open iron pipe.

Coordinates Obtained by GPS

NAD 83 (1996 Adjustment)

N-148083.722

E-486968.107

Index No. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North 1/4 Corner of Section 20, Township 37, Range 30, 4 P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

On _____ found a _____
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES



Filed under South 1/4 corner Section 17, T37 R30

Certificate #147251

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE _____ DATE _____

Registration No. _____

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of _____

I hereby certify that this document was filed in the Reg. of Deeds office at _____ M. on the _____ day of _____ A.D., 19 ____

Register of Deeds _____

By _____ Deputy _____

DOCUMENT NO. _____