

Certified, Filed and or Recorded on  
July 29, 2014 12:58 PM

BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

By: OC

6 -- V -- I


## CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH 1/4 Corner of Section 9, Township 38, Range 29  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 5/13/2014 found a 1/2" IRON PIPE MARKED "RLS 1955Z"  
FLUSH IN E OF ROAD

left monument as found  lowered monument  removed monument (explain)  
 On \_\_\_\_\_ placed an \_\_\_\_\_

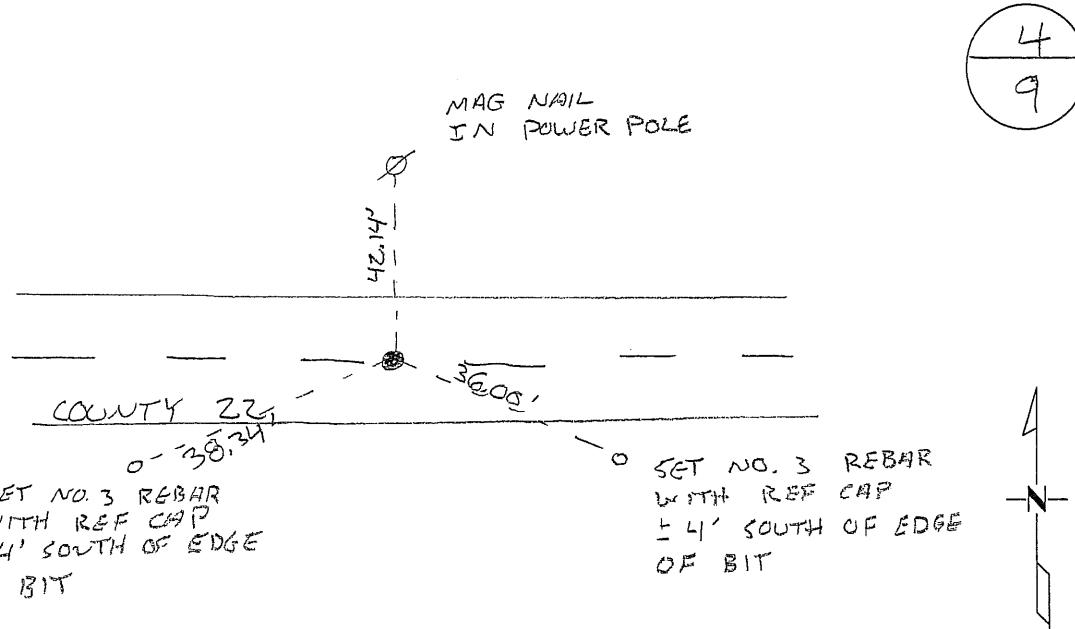

Statement of evidence for this corner location is on back of this page.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Signature Jerome C. Wittstock  
Jerome C. Wittstock, PS, CFedS, Benton County Surveyor  
License No. 19552

Date: 7-29-2014

Benton County Surveyor's Office  
 Jerome C. Wittstock, County Surveyor  
 Minnesota License No. 19552

Statement of Evidence:

B091

North Quarter Corner of Section 9, Township 38 North, Range 29 West, Alberta  
 Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at the location and bearing trees were recorded.

6" Aspen	S 74 1/2 W	37 links
9" Aspen	N 50 W	31 links

1939 County Engineer's Notebook No. 128 contains survey of CAR 22 running east to west on section line. Corner is shown as a spike set in center of road in line with fence north. Ties:

FP	N	44.7'
FP	NW	42.8'

Stationing gives distances of 2670.5 feet to the NE corner and 2631.7 feet to the NW corner with a delta angle of 1-12' left.

1964 County Engineer's Notebook No. 276 contains survey of CSAH 22 running west to east on section line. Corner is shown as a spike set in center of road in line with fence north. Ties:

PP	N	42.0
TP	SE	55.9

Stationing gives distances of 2632.8 feet to the NW corner and 2670.6 feet to the NE corner.

2008 The County Surveyor's Office searched and found a metal reading deep under the bituminous at centerline of an east-west road (County Road 22) and on line with an old fenceline leading to the north. A PP to the North agreed with that from 1939. The Distance to the NW and NE Corners measures 2632.85 ft. and 2670.97 ft., respectively, with a deflection angle (from east to west) measured as 1°12'45" left, which compares well with 1939 dimensions, above. The Surveyor accepts the position and set a PK Nail with disk over the metal reading and made new ties.

County Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-191332.538  
 E-523642.123

2010 The County Surveyor's Office removed the PK Nail and searched for a subsurface monument. A 18-inch by 18-inch by 3-foot deep hole was dug. No metal reading was found at the corner position. The position determined in 2008 was accepted as marking the obliterated corner position and a 1/2-inch by 14-inch iron pipe capped 19552 was set at the position.