

Certified, Filed and or Recorded on  
October 18, 2011 2:45 PM

BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

By: BW

G -- V -- 1


## CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 7, Township 38, Range 29  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10/11/2011 found a CAST IRON MONUMENT

left monument as found  lowered monument  removed monument (explain)  
 On \_\_\_\_\_ placed an \_\_\_\_\_

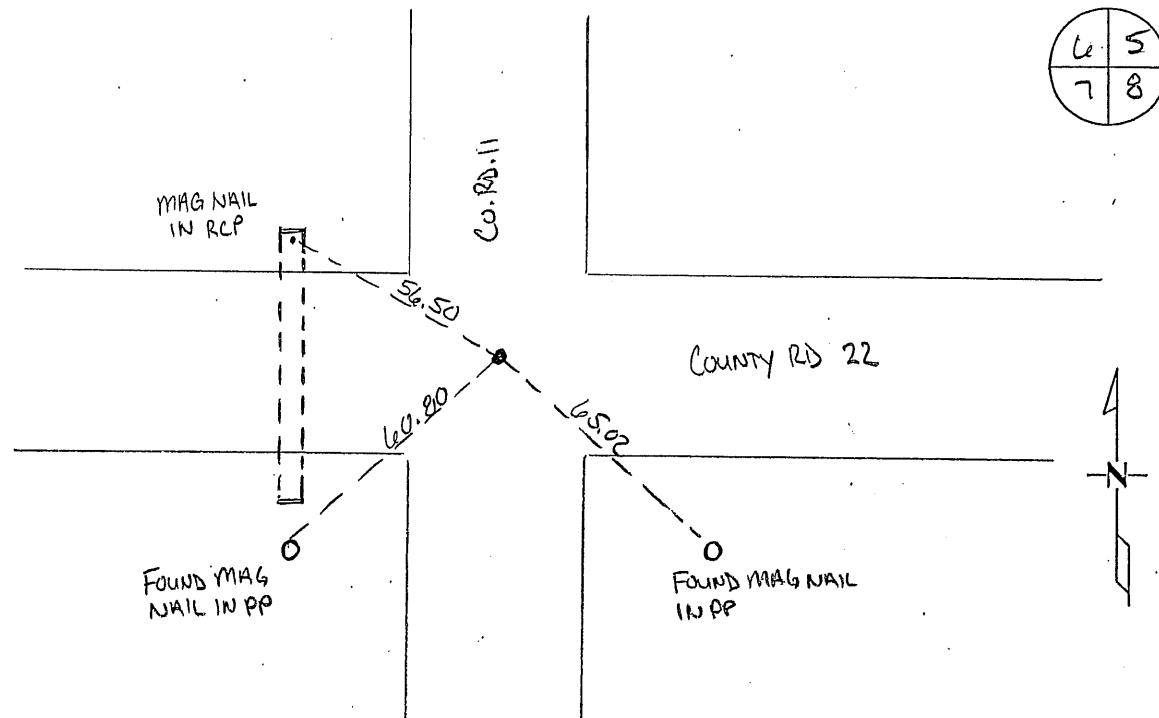

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wettstock  
Benton County Surveyor  
License No. 19552

Date: 14 Oct. 2011

Benton County Surveyor's Office  
 Jerome C. Wittstock, County Surveyor  
 Minnesota License No. 19552  
 Page 1 of 2

**Statement of Evidence:**

**B072**

Northeast Corner of Section 7, Township 38 North, Range 29 West, Alberta Township,  
 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at the location and  
 bearing trees were recorded.

|             |            |          |
|-------------|------------|----------|
| 7" Tamarack | N 48 1/2 W | 26 links |
| 7" Tamarack | S 22 1/2 W | 24 links |

1930 County Engineer's notebook No. 79 (Elletson) list ties to an iron pipe:

|                    |      |       |
|--------------------|------|-------|
| Cor. F.P.          | NW   | 30.2' |
| West Mail Box Post | East | 36.8' |
| Cor F. P.          | SE   | 29.3' |

1935 County Engineer's Notebook No. 93 contains survey for Road running from south  
 to north. Notes corner as an iron with town road west and east. Ties:

|               |    |      |
|---------------|----|------|
| Hub           | SW | 43.5 |
| W. Mail Box P |    | 37.1 |

1939 County Engineer's Notebook No. 128 contains survey of CAR 22 running east to  
 west on section line. Corner is shown as an iron pipe in center of 4-way road  
 intersection. Ties:

|              |    |       |
|--------------|----|-------|
| E. End Culv. | SE | 40.2' |
| W. End Culv. | SW | 38.4' |

1963 Notebook No. 93 notes ties to an iron pipe:

|    |    |       |
|----|----|-------|
| PP | NW | 46.1  |
| PP | SW | 48.15 |
| TP | NE | 45.5  |

1964 County Engineer's Notebook No. 246 contains survey for CSAH 11 running  
 south to north on section line. Notes show corner marked by an iron in center of  
 road with CSAH 22 east and west. Ties are the same as in 1963 and 1967.

1964 County Engineer's Notebook No. 276 contains a road survey for CSAH No. 22  
 running west to east on section line. Same information as above.

1967 Milner Carley ties to an iron pipe:

|           |    |       |
|-----------|----|-------|
| PP        | NW | 54.4  |
| Sign Post | NE | 67.85 |

1969 County Engineer Kotsmith notes the following reference ties to an iron:

|               |    |      |
|---------------|----|------|
| W end Culvert | SE | 40.2 |
| W end Culvert | SW | 38.4 |
| Stop Sign     | NW | 54.7 |

Benton County Surveyor's Office  
 Jerome C. Wittstock, County Surveyor  
 Minnesota License No. 19552  
 Page 2 of 2

PP SW 67.9

1974 County Surveyor's Record Book 2, page 250, notes the following reference ties to an iron.

|           |    |      |
|-----------|----|------|
| Stop Sign | NE | 41.7 |
| PP        | NW | 54.4 |
| PP        | SW | 54.9 |

Older ties to a iron pipe:

|                    |    |      |
|--------------------|----|------|
| Cor. FP            | NW | 30.2 |
| West Mail Box Post | E  | 36.8 |
| Cor. FP            | SE | 29.3 |

1988 William Lunser, LS 9394, found a 1" pin over a 1 1/2" pipe at centerline/centerline. He set a cast iron monument over the 1 1/2" pipe and filed a Certificate of Location (#191251). He notes a distance of 2697.28 feet to the North 1/4 corner Sec 7.

2001 Westwood Professional Services, Inc. found a cast iron monument at centerline/centerline.

2011 The Benton County Surveyor's Office found the cast iron monument, however none of the 1998 ties remained. The CIM measures within 0.2 feet of the 1988 distance to the west. Believing the CIM to be the same as the one set in 1988, and the iron pin over the iron pipe found in 1988 to be the same iron pipe first mentioned in 1930 by Elletson, it is accepted as marking the obliterated corner position.

Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-191284.768  
 E-515710.379

## CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 7, Township 38, Range 29, 4<sup>th</sup> P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

On 5-13-88 found a 1" pin and below a 1½" pipe

DATE


left monument as found,  lowered monument,  removed monument (explain)

On 5-13-88 placed a Benton County Cast Iron Monument on top

DATE

of 1½" iron pipe

## SKETCH OF REFERENCE TIES

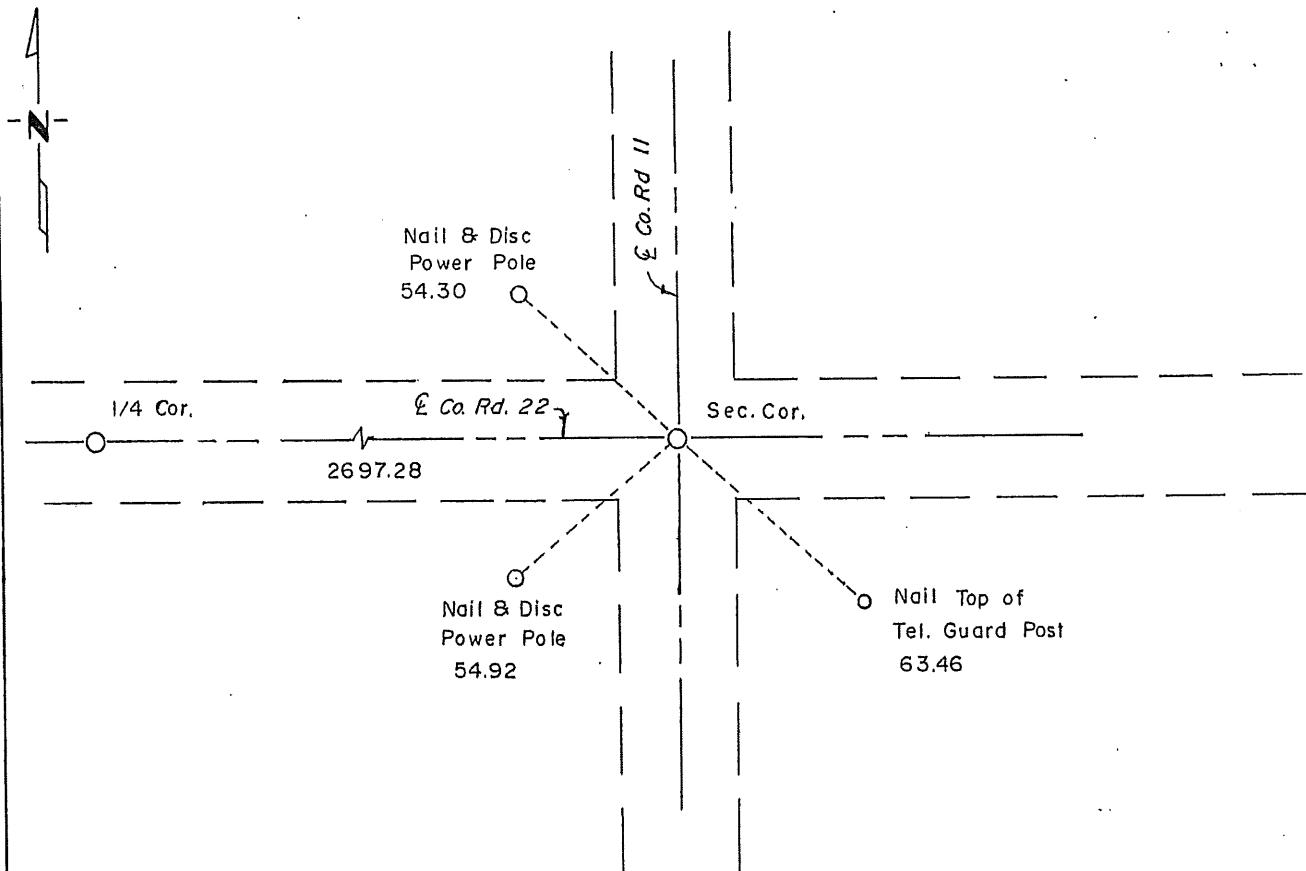

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Walter F. Johnson 12/15/88  
SIGNATURE DATE

Registration No. 9394

Land Surveyor,  Professional Engineer

County Surveyor,  County Engineer

## OFFICE OF THE REGISTER OF DEEDS

County of \_\_\_\_\_

I hereby certify that this document was filed in the Reg. of Deeds office at \_\_\_\_\_ M. on the \_\_\_\_\_ day of \_\_\_\_\_ A.D., 19\_\_\_\_

Register of Deeds \_\_\_\_\_

By \_\_\_\_\_, Deputy

DOCUMENT NO. \_\_\_\_\_

Statement of Evidence:

1963- County road plans show pin was set at center-center of roads and ties taken.

5-13-88 Two ties remained and verified, drove  $1\frac{1}{2}$ " iron pipe down and placed C.I.M. on top.

1 9 1 2 5 1

OFFICE OF  
BENTON COUNTY RECORDER  
BENTON COUNTY, TN  
CERTIFIED TO BE FILED  
AND/OR INDEXED ON  
JAN 12 11 59 AM '89  
ALICE S. ENGELMAYER  
COUNTY RECORDER  
BY Jed DEPUTY